MSI-9300 and MSI-4300 Crane Scale Cage Kit

The following instructions are a guide to install the Crane Scale Cage Kit to the MSI-9300/MSI-4300 crane scales.

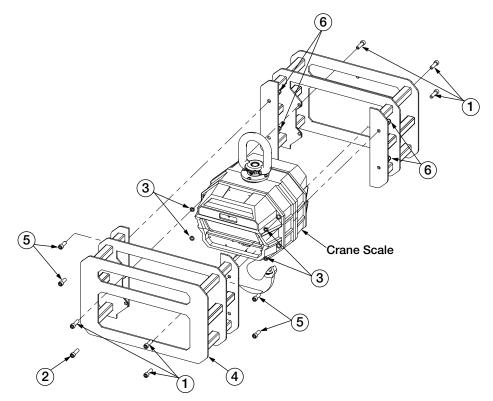


Figure 2-9. Illustrated Parts

Item No.	Part No.	Description	Qty
1	145998	Screw, Socket Head, 3/8-16 x 1 1/4	7
2	133597	Screw, Seal 3/8-16 x 1 1/4	1
3	167166	Lock Washer	4
4	167158	Crane Scale Cage Weldment	2
5	91869	Socket Head 18-8 SST	4
6	146634	Nut, Hex 3/8-16 Nyloc SS	4

Table 1. Illustrated Parts List



2.2 Installation Procedure

- 1. Place the scale in an easy to reach location.
- 2. Remove the existing four screws securing the front of the scale to the body.

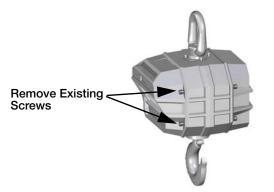


Figure 2-1. Remove Existing Screws

3. Insert three of the socket head screws and the seal screw into the holes on the center plate of one of the cage weldments. See Figure 2-2 for screw arrangement.

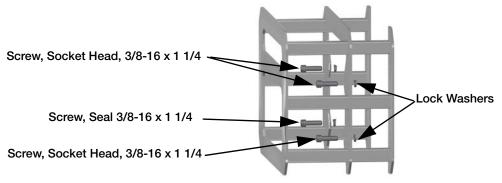


Figure 2-2. Hardware in Front Cage Weldment

- 4. Align a cage weldment to the screw holes on the front of the crane scale.
- 5. Secure cage weldment to scale by tightening the screws.

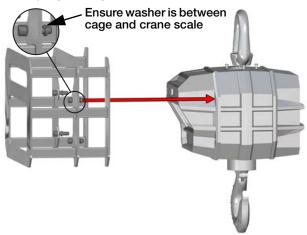


Figure 2-3. Assemble Front Cage Weldment to Crane Scale

6. Remove the screws holding the back of the scale to the body.



- 7. Align the remaining cage weldment to the back of the crane scale.
- 8. Secure using the remaining screws.

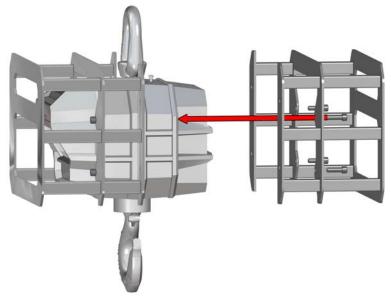


Figure 2-4. Install Back Weldment.

9. Secure the two cage weldments together using the four socket head screws (18-8 SST) and nuts.

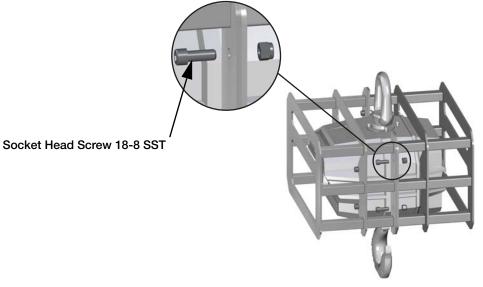


Figure 2-5. Secure Cage Weldments





© Rice Lake Weighing Systems Specifications subject to change without notice. Rice Lake Weighing Systems is an ISO 9001 registered company.

230 W. Coleman St. • Rice Lake, WI 54868 • USA U.S. 800-472-6703 • Canada/Mexico 800-321-6703 • International 715-234-9171 • Europe +31 (0)26 472 1319